



# Home Inspection Report

Prepared for: John Client  
10/01/2019

123 Some Street  
Somewhere, US 12345



Inspected by:  
Will Singer  
Your Company Name Here



Your Company Name Here

Prepared for: John Client  
123 Some Street  
1 of 25  
11/01/2022 04:29 PM

## Table of Contents

Definitions	2
General Information	2
Lots and Grounds	3
Exterior	3
Roof	5
Garage	6
Electrical	7
Attic	8
Structure	9
Basement	10
Air Conditioning	11
Heating System	11
Fireplace/Wood Stove	12
Plumbing	12
Bathroom	13
Bedroom	15
Kitchen	16
Living Space	17
Laundry Room/Area	18
Summary	19



# Your Company Name Here

Prepared for: John Client  
123 Some Street  
2 of 25  
11/01/2022 04:29 PM

## Definitions

NOTE: All definitions listed below refer to the property or item listed as inspected on this report at the time of inspection

A	Acceptable	Functional with no obvious signs of defect.
NP	Not Present	Item not present or not found.
NI	Not Inspected	Item was unable to be inspected for safety reasons or due to lack of power, inaccessible, or disconnected at time of inspection.
M	Marginal	Item is not fully functional and requires repair or servicing.
D	Defective	Item needs immediate repair or replacement. It is unable to perform its intended function.

## General Information

### Property Information

Property Address 123 Some Street  
City Somewhere State US Zip 12345

### Client Information

Client Name John Client  
Client Address 2222 Client Street  
City Client Place State Client Place Zip 12345  
Phone 513-795-2222 Email john@goodclients.org  
  
Referrer Name Sally Referrer  
Phone 513-795-5791 Email sally@goodagents.com

### Inspection Company

Inspector Name Will Singer  
Company Name Your Company Name Here  
Address 1234 Company Lane  
City Somewhere State US Zip 12345  
Phone 123-555-1234  
Email me@myinspectioncompany.com Web www.myinspectioncompany.com  
Amount Due 425 Amount Received 425

### Conditions

Others Present Buyer's Agent and Buyer Property Occupied Occupied  
Estimated Age 31 years Entrance Faces East  
Start Time: 9:00 End Time: 11:45  
Inspection Date 10/01/2019  
Utilities On ☒ Yes ☐ No ☐ Not Applicable  
Weather Partly sunny Soil Conditions Dry  
Space Below Grade Basement  
Building Type Single family Garage Attached  
Water Source City How Verified Multiple Listing Service  
Sewage Disposal City How Verified Multiple Listing Service



## Lots and Grounds

This is the disclaimer section. Each category has a disclaimer section. In this section you can include any relevant text for the category. Common uses for this area include: standards of practice, what the inspector does/does not inspect, general information that the client may find helpful, etc.

There is no limit to the amount of information that is included in the section. It can be a few words or a few pages worth of information. You can also change the color and the font of the text.

A NPNI M D

1. ☒ ☐ ☐ ☐ ☐ Driveway: Concrete
2. ☒ ☐ ☐ ☐ ☐ Walks: Concrete
3. ☐ ☐ ☐ ☐ ☒ Porch: Concrete - Settling away from foundation with surface cracks noted



4. ☒ ☐ ☐ ☐ ☐ Patio: Asphalt pavers
5. ☒ ☐ ☐ ☐ ☐ Grading: Moderate slope
6. ☐ ☐ ☐ ☒ ☐ Vegetation: Trees, Shrubs - Keep plantings trimmed away from foundation and roof areas
7. ☒ ☐ ☐ ☐ ☐ Window Wells: Drain present
8. ☒ ☐ ☐ ☐ ☐ Retaining Walls: Stone
9. ☒ ☐ ☐ ☐ ☐ Fences: Vinyl

## Exterior

A NPNI M D

1st Floor Exterior Surface \_\_\_\_\_

1. ☐ ☐ ☐ ☒ ☐ Type: Brick veneer - Some damaged bricks, Recommend sealing brick with penetration sealer products



2nd Floor Exterior Surface \_\_\_\_\_

## Exterior (Continued)

2. ☐☐☐☒☐ Type: Vinyl siding - Damaged front shutter, Chalking noted due to age, One panel needs to be repositioned at rear elevation



3. ☐☐☐☒☐ Trim: Aluminum - Chalking noted due to age, Loose nails in areas  
4. ☒☐☐☐☐ Fascia: Aluminum  
5. ☐☐☐☒☐ Soffits: Vinyl - Loose/sagging at front porch  
6. ☒☐☐☐☐ Door Bell: Hard wired  
7. ☒☐☐☐☐ Entry Doors: Wood  
8. ☐☐☐☒☐ Patio Door: Vinyl sliding - Resecure loose handle hardware, Screen damage noted  
9. ☐☐☐☒☐ Windows: Vinyl insulated - Reseal caulking at window perimeters at brick window openings



10. ☒☐☐☐☐ Window Screens: Metal  
11. ☒☐☐☐☐ Basement Windows: Vinyl casement  
12. ☒☐☐☐☐ Exterior Lighting: Surface mount  
13. ☒☐☐☐☐ Exterior Electric Outlets: 110 VAC GFCI  
14. ☐☐☐☒☐ Hose Bibs: Gate - Properly secure fixture(s) to exterior wall with fasteners  
15. ☒☐☐☐☐ Gas Meter: Exterior surface mount at side of home - Rust present, Keep bushes and shrubs away from meter



16. ☒☐☐☐☐ Main Gas Valve: Located at gas meter

## Roof

A NPNI M D

### Main Roof Surface

#### 1. Method of Inspection: On roof



2. ☒ ☐ ☐ ☐ ☐ Unable to Inspect: 0%
3. ☒ ☐ ☐ ☐ ☐ Material: Fiberglass shingle
4. Type: Gable
5. Approximate Age: 5
6. ☒ ☐ ☐ ☐ ☐ Flashing: Metal
7. ☒ ☐ ☐ ☐ ☐ Plumbing Vents: Copper
8. ☒ ☐ ☐ ☐ ☐ Electrical Mast: Underground utilities
9. ☐ ☐ ☐ ☒ ☐ Gutters: Aluminum - Loose nails, Sagging gutters at front and rear



10. ☒ ☐ ☐ ☐ ☐ Downspouts: Aluminum
11. ☐ ☐ ☐ ☒ ☐ Leader/Extension: Splash blocks - Splash block(s) not properly installed



### Right side Chimney

12. ☒ ☐ ☐ ☐ ☐ Chimney: Brick

## Roof (Continued)

13. ☐☐☒☐☐ Flue/Flue Cap: Clay tile - Weather cap obstructed view of flue



14. ☒☐☐☐☐ Chimney Flashing: Galvanized

## Garage

A NPNI M D

### Attached Garage

1. Type of Structure: Attached Car Spaces: 2
2. ☒☐☐☐☐ Garage Doors: Insulated aluminum
3. ☒☐☐☐☐ Door Operation: Mechanized
4. ☒☐☐☐☐ Door Opener: Overhead Door
5. ☒☐☐☐☐ Exterior Surface: Brick veneer
6. ☒☐☐☐☐ Roof: Asphalt shingle
7. ☒☐☐☐☐ Roof Structure: 2x6 Rafter
8. ☐☐☐☐☒ Service Doors: Wood - **Wood rot at bottom of door and frame**




9. ☒☐☐☐☐ Ceiling: Drywall
10. ☐☐☐☒☐ Walls: Drywall - **Hole(s) noted in walls**
11. ☐☐☐☒☐ Floor/Foundation: Poured concrete - **Minor floor cracks noted-seal cracks**
12. ☒☐☐☐☐ Hose Bibs: Gate
13. ☐☐☐☒☐ Electrical: 110 VAC - **Fluorescent lighting missing covers and lenses**
14. ☐☒☐☐☐ Smoke Detector:
15. ☒☐☐☐☐ Windows: Vinyl Insulated
16. ☒☐☐☐☐ Gutters: Aluminum
17. ☒☐☐☐☐ Downspouts: Aluminum



## Electrical

A NPNI M D

1. Service Size Amps: 200 Volts: 120/240 VAC
2. ☒ ☐ ☐ ☐ ☐ Service: Aluminum
3. ☐ ☐ ☐ ☒ ☐ 120 VAC Branch Circuits: Copper and aluminum - Evaluation by a licensed electrician is recommended, See aluminum wiring notes below
4. ☒ ☐ ☐ ☐ ☐ 240 VAC Branch Circuits: Copper
5. ☐ ☐ ☐ ☒ ☐ Aluminum Wiring: Present at several circuits - Aluminum branch wiring has had a history of problems relating to poor connections due to galvanic corrosion, dissimilar metals, brittle conductors and type of aluminum alloy used during the time period of 1965 through 1972. These problems create unsatisfactory conditions at connections and splice locations and therefore create potential fire hazards. Recommend wiring update for aluminum wiring by a licensed electrician, Circuits are recommended to be upgraded with special compression type connectors at splices and branch circuits to reduce the potential risks of aluminum branch wiring.(Cop-Alum Crimp System)

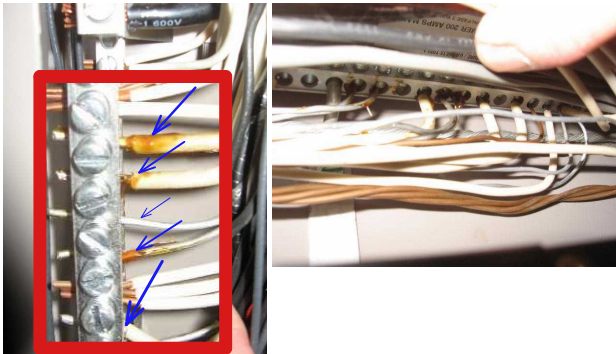

6. ☒ ☐ ☐ ☐ ☐ Conductor Type: Romex, Non-metallic sheathed cable
7. ☒ ☐ ☐ ☐ ☐ Ground: Plumbing and rod in ground
8. ☒ ☐ ☐ ☐ ☐ Smoke Detectors: Hard wired with battery back up and light

Basement Electric Panel

9. ☒ ☐ ☐ ☐ ☐ Manufacturer: Cutler-Hammer



10. Maximum Capacity: 200 Amps
11. ☒ ☐ ☐ ☐ ☐ Main Breaker Size: 200 Amps
12. ☒ ☐ ☐ ☐ ☐ Breakers: Copper
13. ☒ ☐ ☐ ☐ ☐ AFCI: 110 volt
14. ☒ ☐ ☐ ☐ ☐ GFCI: Present



## Electrical (Continued)

15. Is the panel bonded? ☒ Yes ☐ No

## Attic

A NPNI M D

Attached Garage Attic

1. Method of Inspection: In the attic
2. ☒ ☐ ☐ ☐ ☐ Unable to Inspect: 15% - Safety and footing
3. ☐ ☐ ☐ ☒ ☐ Roof Framing: 2x3/4 Truss - Wood blocking components missing at chimney perimeter



4. ☐ ☐ ☐ ☒ ☐ Sheathing: Plywood - Water stains and slight damage present, Areas of sheathing have been repaired



5. ☒ ☐ ☐ ☐ ☐ Ventilation: Ridge and soffit vents
6. ☒ ☐ ☐ ☐ ☐ Insulation: Fiberglass loose fill
7. ☒ ☐ ☐ ☐ ☐ Insulation Depth: 4"
8. ☒ ☐ ☐ ☐ ☐ Wiring/Lighting: 110 VAC

Main Attic

9. Method of Inspection: In the attic
10. ☒ ☐ ☐ ☐ ☐ Unable to Inspect: 10% - Safety and footing
11. ☒ ☐ ☐ ☐ ☐ Roof Framing: 2x3/4 Truss
12. ☐ ☐ ☐ ☒ ☐ Sheathing: Plywood - Poor repair at 2 areas near ridge at rear slope - No H clips installed and repair only spanned one truss - Recommend additional support be installed

## Attic (Continued)

Sheathing: (continued)



13. ☒ ☐ ☐ ☐ ☐ Ventilation: Gable vent(s), Ridge vent(s)  
14. ☒ ☐ ☐ ☐ ☐ Insulation: Fiberglass loose fill  
15. ☒ ☐ ☐ ☐ ☐ Insulation Depth: 6"

## Structure

A NP NI M D

1. ☒ ☐ ☐ ☐ ☐ Structure Type: Wood frame  
2. ☒ ☐ ☐ ☐ ☐ Foundation: Poured concrete  
3. ☒ ☐ ☐ ☐ ☐ Differential Movement: Slight settlement present - Minor settlement at front porch, Cracks will require monitoring  
4. ☒ ☐ ☐ ☐ ☐ Beams: Steel I-Beam  
5. ☒ ☐ ☐ ☐ ☐ Bearing Walls: Wood frame  
6. ☐ ☐ ☐ ☒ ☐ Joists/Trusses: 2x10 - Areas not visible due to ceiling finishes or other obstructions, Framing joist near fireplace chimney shows evidence of previous termite infestation - No repairs required, Seal penetration as required



7. ☒ ☐ ☐ ☐ ☐ Piers/Posts: Steel posts  
8. ☒ ☐ ☐ ☐ ☐ Stairs/Handrails: Wood stairs with wood handrails  
9. ☒ ☐ ☐ ☐ ☐ Subfloor: Plywood

## Basement

A NPNI M D

### Main Basement

1. ☒ ☐ ☐ ☐ ☐ Unable to Inspect: 0%



2. ☒ ☐ ☐ ☐ ☐ Ceiling: Suspended Acoustical System - Evidence of past water staining

3. ☒ ☐ ☐ ☐ ☐ Walls: Drywall



4. ☐ ☐ ☐ ☒ ☐ Floor: Carpet - Carpet stains noted

5. ☒ ☐ ☐ ☐ ☐ Floor Drain: Surface drain

6. ☒ ☐ ☐ ☐ ☐ Doors: Hollow wood

7. ☒ ☐ ☐ ☐ ☐ Windows: Vinyl casement

8. ☐ ☐ ☐ ☒ ☐ Electrical: 110 VAC - Loose junction boxes, missing and mis-sized covers, extension cord wiring to projector

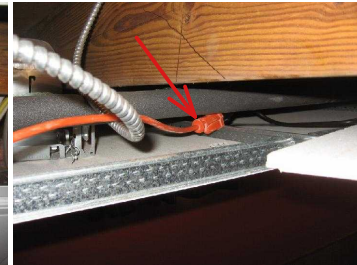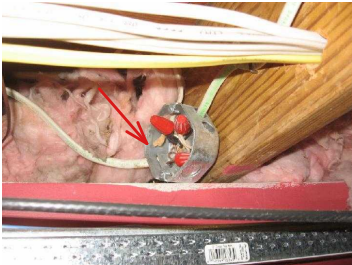

9. ☒ ☐ ☐ ☐ ☐ HVAC Source: Air exchange ventilation

10. ☒ ☐ ☐ ☐ ☐ Insulation: Fiberglass insulation at rim joist areas

11. ☒ ☐ ☐ ☐ ☐ Ventilation: Windows

12. ☒ ☐ ☐ ☐ ☐ Sump Pump: Submerged

13. ☒ ☐ ☐ ☐ ☐ Basement Stairs/Railings: Wood stairs with wood handrails

## Air Conditioning

A NPNI M D

### Main AC System

1. ☒ ☐ ☐ ☐ ☐ A/C System Operation: Appears serviceable
2. ☒ ☐ ☐ ☐ ☐ Condensate Removal: Plastic tubing
3. ☒ ☐ ☐ ☐ ☐ Exterior Unit: Pad mounted



4. Manufacturer: Rheem
5. Area Served: Whole house Approximate Age: 7
6. Fuel Type: 110 VAC Temperature Differential: 16 degrees
7. Type: Central A/C Capacity: 3 Ton
8. ☒ ☐ ☐ ☐ ☐ Visible Coil: Copper core with aluminum fins
9. ☒ ☐ ☐ ☐ ☐ Refrigerant Lines: Serviceable condition
10. ☒ ☐ ☐ ☐ ☐ Electrical Disconnect: Breaker disconnect
11. ☒ ☐ ☐ ☐ ☐ Exposed Ductwork: Metal
12. ☒ ☐ ☐ ☐ ☐ Blower Fan/Filters: Direct drive with electronic filter
13. ☒ ☐ ☐ ☐ ☐ Thermostats: Single Zone

## Heating System

A NPNI M D

### Basement Heating System

1. ☒ ☐ ☐ ☐ ☐ Heating System Operation: Appears functional



2. Manufacturer: Ducane
3. Type: Forced air Capacity: 100,000 BTUHR
4. Area Served: Whole house Approximate Age: 6
5. Fuel Type: Natural gas
6. ☒ ☐ ☐ ☐ ☐ Heat Exchanger: 5 Burner



## Heating System (Continued)

7. Unable to Inspect: 20%
8. ☒ ☐ ☐ ☐ ☐ Blower Fan/Filter: Direct drive with electronic filter
9. ☒ ☐ ☐ ☐ ☐ Distribution: Metal duct
10. ☒ ☐ ☐ ☐ ☐ Draft Control: Automatic
11. ☒ ☐ ☐ ☐ ☐ Flue Pipe: Double wall
12. ☒ ☐ ☐ ☐ ☐ Controls: Limit switch
13. ☐ ☐ ☐ ☐ ☒ Humidifier: General - **Inoperative - Requires service/replacement**
14. ☒ ☐ ☐ ☐ ☐ Thermostats: Single Zone
15. Suspected Asbestos: No

## Fireplace/Wood Stove

A NP NI M D

Family Room Fireplace

1. ☒ ☐ ☐ ☐ ☐ Fireplace Construction: Masonry
2. Type: Wood burning
3. ☒ ☐ ☐ ☐ ☐ Fireplace Insert: Standard
4. ☒ ☐ ☐ ☐ ☐ Smoke Chamber: Brick
5. ☒ ☐ ☐ ☐ ☐ Flue: Clay tile
6. ☒ ☐ ☐ ☐ ☐ Damper: Metal
7. ☒ ☐ ☐ ☐ ☐ Hearth: Raised

## Plumbing

A NP NI M D

1. ☒ ☐ ☐ ☐ ☐ Service Line: Copper
2. ☒ ☐ ☐ ☐ ☐ Main Water Shutoff: Basement
3. ☒ ☐ ☐ ☐ ☐ Water Lines: Copper
4. ☐ ☐ ☐ ☐ ☒ Drain Pipes: Cast iron, Copper - **Pitting cast iron drain piping stack - replace affected sections where required**



5. ☒ ☐ ☐ ☐ ☐ Service Caps: Accessible
6. ☒ ☐ ☐ ☐ ☐ Vent Pipes: Copper
7. ☒ ☐ ☐ ☐ ☐ Gas Service Lines: Black Iron

## Plumbing (Continued)

### Utility Room Water Heater


8. ☒ ☐ ☐ ☐ ☐ Water Heater Operation: Functional at time of inspection
9. Manufacturer: Ruud
10. Type: Natural gas Capacity: 40 Gal.
11. Approximate Age: 9 Area Served: Whole house
12. ☒ ☐ ☐ ☐ ☐ Flue Pipe: Single wall metal
13. ☒ ☐ ☐ ☐ ☐ TPRV and Drain Tube: Brass/Copper

## Bathroom

A NPNI M D

### Master Bathroom

1. ☒ ☐ ☐ ☐ ☐ Ceiling: Drywall
2. ☒ ☐ ☐ ☐ ☐ Walls: Drywall
3. ☐ ☐ ☐ ☒ ☐ Floor: Laminated flooring - Gapping noted in planks
4. ☒ ☐ ☐ ☐ ☐ Doors: Hollow wood
5. ☒ ☐ ☐ ☐ ☐ Windows: Vinyl Insulated
6. ☒ ☐ ☐ ☐ ☐ Electrical: GFCI
7. ☒ ☐ ☐ ☐ ☐ Counter/Cabinet: Wood
8. ☒ ☐ ☐ ☐ ☐ Sink/Basin: One piece sink/counter top
9. ☒ ☐ ☐ ☐ ☐ Faucets/Traps: Delta
10. ☐ ☐ ☐ ☒ ☐ Shower/Surround: Ceramic tile - Leaking at corner of door frame

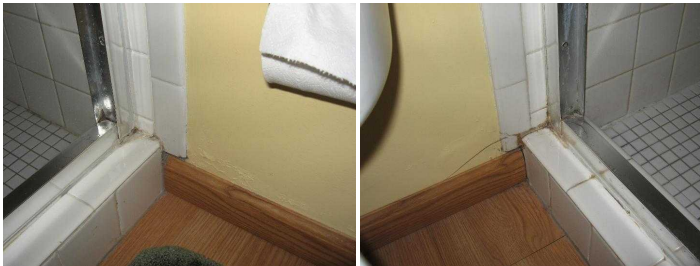

11. ☒ ☐ ☐ ☐ ☐ Toilets: Porcelain
12. ☒ ☐ ☐ ☐ ☐ HVAC Source: Air exchange ventilation
13. ☒ ☐ ☐ ☐ ☐ Ventilation: Window

### 2nd Floor Hall Bathroom

14. ☐ ☐ ☐ ☒ ☐ Closet: Large - Alignment needed at closet doors
15. ☒ ☐ ☐ ☐ ☐ Ceiling: Drywall
16. ☒ ☐ ☐ ☐ ☐ Walls: Drywall
17. ☐ ☐ ☐ ☒ ☐ Floor: Laminated flooring - Gapping noted in planks
18. ☒ ☐ ☐ ☐ ☐ Doors: Hollow wood
19. ☒ ☐ ☐ ☐ ☐ Windows: Vinyl Insulated
20. ☒ ☐ ☐ ☐ ☐ Electrical: GFCI
21. ☒ ☐ ☐ ☐ ☐ Counter/Cabinet: Wood
22. ☒ ☐ ☐ ☐ ☐ Sink/Basin: One piece sink/counter top

## Bathroom (Continued)

23. ☐☐☐☐☒ Faucets/Traps: Delta fixtures with a metal trap - **Leaking shower head, Loose trim rings**



24. ☒☐☐☐☐ Tub/Surround: Porcelain tub and ceramic tile surround  
25. ☒☐☐☐☐ Toilets: Porcelain  
26. ☒☐☐☐☐ HVAC Source: Air exchange ventilation  
27. ☒☐☐☐☐ Ventilation: Window

1st Floor Hall Half Bathroom

28. ☒☐☐☐☐ Ceiling: Drywall  
29. ☒☐☐☐☐ Walls: Drywall  
30. ☐☐☐☒☐ Floor: Ceramic tile - **Cracked tile noted**



31. ☒☐☐☐☐ Doors: Solid wood  
32. ☒☐☐☐☐ Windows: Vinyl Insulated  
33. ☒☐☐☐☐ Electrical: GFCI  
34. ☒☐☐☐☐ Counter/Cabinet: Laminate and wood  
35. ☒☐☐☐☐ Sink/Basin: One piece sink/counter top  
36. ☒☐☐☐☐ Faucets/Traps: Delta fixtures with a metal trap  
37. ☒☐☐☐☐ Toilets: Porcelain  
38. ☒☐☐☐☐ HVAC Source: Air exchange ventilation  
39. ☒☐☐☐☐ Ventilation: Window



# Your Company Name Here

Prepared for: John Client  
123 Some Street  
15 of 25  
11/01/2022 04:29 PM

## Bedroom

A NPNI M D

### 2nd Floor Master Bedroom

1. ☒ ☐ ☐ ☐ ☐ Closet: Walk In and Large
2. ☒ ☐ ☐ ☐ ☐ Ceiling: Drywall
3. ☒ ☐ ☐ ☐ ☐ Walls: Drywall
4. ☒ ☐ ☐ ☐ ☐ Floor: Carpet
5. ☒ ☐ ☐ ☐ ☐ Doors: Solid wood
6. ☒ ☐ ☐ ☐ ☐ Windows: Vinyl Insulated
7. ☒ ☐ ☐ ☐ ☐ Electrical: 110 VAC
8. ☒ ☐ ☐ ☐ ☐ HVAC Source: Air exchange ventilation
9. ☒ ☐ ☐ ☐ ☐ Smoke Detector: Hard wired with battery back up and light

### Middle Bedroom

10. ☒ ☐ ☐ ☐ ☐ Closet: Large
11. ☒ ☐ ☐ ☐ ☐ Ceiling: Drywall
12. ☒ ☐ ☐ ☐ ☐ Walls: Drywall
13. ☒ ☐ ☐ ☐ ☐ Floor: Carpet
14. ☒ ☐ ☐ ☐ ☐ Doors: Hollow wood
15. ☒ ☐ ☐ ☐ ☐ Windows: Vinyl Insulated
16. ☒ ☐ ☐ ☐ ☐ Electrical: 110 VAC
17. ☒ ☐ ☐ ☐ ☐ HVAC Source: Air exchange ventilation
18. ☒ ☐ ☐ ☐ ☐ Smoke Detector: Hard wired with battery back up and light in 2nd floor hallway

### Southeast Bedroom

19. ☒ ☐ ☐ ☐ ☐ Closet: Large
20. ☒ ☐ ☐ ☐ ☐ Ceiling: Drywall
21. ☒ ☐ ☐ ☐ ☐ Walls: Drywall
22. ☒ ☐ ☐ ☐ ☐ Floor: Carpet
23. ☒ ☐ ☐ ☐ ☐ Doors: Solid wood
24. ☒ ☐ ☐ ☐ ☐ Windows: Vinyl Insulated
25. ☒ ☐ ☐ ☐ ☐ Electrical: 110 VAC
26. ☒ ☐ ☐ ☐ ☐ HVAC Source: Air exchange ventilation
27. ☒ ☐ ☐ ☐ ☐ Smoke Detector: Hard wired with battery back up and light in 2nd floor hallway

### Southwest Bedroom

28. ☒ ☐ ☐ ☐ ☐ Closet: Large
29. ☒ ☐ ☐ ☐ ☐ Ceiling: Drywall
30. ☒ ☐ ☐ ☐ ☐ Walls: Drywall
31. ☒ ☐ ☐ ☐ ☐ Floor: Hardwood
32. ☒ ☐ ☐ ☐ ☐ Doors: Hollow wood
33. ☒ ☐ ☐ ☐ ☐ Windows: Vinyl Insulated
34. ☒ ☐ ☐ ☐ ☐ Electrical: 110 VAC
35. ☒ ☐ ☐ ☐ ☐ HVAC Source: Air exchange ventilation
36. ☒ ☐ ☐ ☐ ☐ Smoke Detector: Hard wired with battery back up and light in 2nd floor hallway



## Kitchen

A NPNI M D

### 1st Floor Kitchen

1. ☒ ☐ ☐ ☐ ☐ Cooking Appliances: Frigidaire
2. ☒ ☐ ☐ ☐ ☐ Disposal: General Electric
3. ☐ ☐ ☐ ☒ ☐ Dishwasher: Maytag - Properly secure the dishwasher discharge hose so that it creates a "high loop" above the basin drain to minimize food or water backup under dishwasher



4. Air Gap Present? ☐ Yes ☒ No

5. ☒ ☐ ☐ ☐ ☐ Refrigerator: Amana
6. ☒ ☐ ☐ ☐ ☐ Microwave: General Electric
7. ☐ ☐ ☐ ☒ ☐ Sink: Stainless Steel - Chipping at drain
8. ☒ ☐ ☐ ☐ ☐ Electrical: 110 VAC GFCI
9. ☒ ☐ ☐ ☐ ☐ Plumbing/Fixtures: Stainless Steel
10. ☒ ☐ ☐ ☐ ☐ Counter Tops: Solid Surface
11. ☒ ☐ ☐ ☐ ☐ Cabinets: Wood - Loose cabinet door hinges
12. ☒ ☐ ☐ ☐ ☐ Pantry: Large
13. ☒ ☐ ☐ ☐ ☐ Ceiling: Drywall
14. ☒ ☐ ☐ ☐ ☐ Walls: Drywall
15. ☒ ☐ ☐ ☐ ☐ Floor: Ceramic tile
16. ☒ ☐ ☐ ☐ ☐ Doors: Hollow wood
17. ☐ ☐ ☐ ☐ ☒ Windows: Vinyl Insulated - Insulated glass unit seal failure



18. ☒ ☐ ☐ ☐ ☐ HVAC Source: Air exchange ventilation

## Living Space

A NPNI M D

### 1st Floor Living Space

1. ☐ ☐ ☐ ☒ ☐ Closet: Various - Missing door glides at bypass closet door in Foyer



2. ☒ ☐ ☐ ☐ ☐ Ceiling: Drywall

3. ☒ ☐ ☐ ☐ ☐ Walls: Drywall

4. ☐ ☐ ☐ ☒ ☐ Floor: Ceramic tile, Carpet, Hardwood - Worn wood finish in Family room



5. ☒ ☐ ☐ ☐ ☐ Doors: Solid wood

6. ☒ ☐ ☐ ☐ ☐ Windows: Vinyl Insulated

7. ☒ ☐ ☐ ☐ ☐ Electrical: 110 VAC - Replace missing dimmer switch in Dining room



8. ☒ ☐ ☐ ☐ ☐ HVAC Source: Air exchange ventilation

9. ☒ ☐ ☐ ☐ ☐ Smoke Detector: Hard wired with battery back up and light



Your Company Name Here

Prepared for: John Client  
123 Some Street  
18 of 25  
11/01/2022 04:29 PM

## Laundry Room/Area

A NPNI M D

### Basement Laundry Room/Area

1. ☒ ☐ ☐ ☐ ☐ Ceiling: Exposed framing
2. ☒ ☐ ☐ ☐ ☐ Walls: Concrete
3. ☒ ☐ ☐ ☐ ☐ Floor: Poured
4. ☒ ☐ ☐ ☐ ☐ Doors: Hollow wood
5. ☒ ☐ ☐ ☐ ☐ Electrical: 110 VAC
6. ☒ ☐ ☐ ☐ ☐ Smoke Detector: Hard wired with battery back up and light
7. ☒ ☐ ☐ ☐ ☐ HVAC Source: Air exchange ventilation
8. ☒ ☐ ☐ ☐ ☐ Laundry Tub: Concrete
9. ☒ ☐ ☐ ☐ ☐ Laundry Tub Drain: Copper
10. ☒ ☐ ☐ ☐ ☐ Washer Hose Bib: Gate valves
11. ☒ ☐ ☐ ☐ ☐ Washer and Dryer Electrical: 120/240 VAC
12. ☒ ☐ ☐ ☐ ☐ Dryer Vent: Metal flex
13. ☒ ☐ ☐ ☐ ☐ Washer Drain: Drains to laundry tub
14. ☒ ☐ ☐ ☐ ☐ Floor Drain: Surface drain

## Marginal Summary

This summary is not the entire report. The complete report may include additional information of concern to the client. It is recommended that the client read the complete report.

### Lots and Grounds

1. Vegetation: Trees, Shrubs - **Keep plantings trimmed away from foundation and roof areas**

### Exterior

2. 1st Floor Exterior Surface Type: Brick veneer - **Some damaged bricks, Recommend sealing brick with penetration sealer products**



3. 2nd Floor Exterior Surface Type: Vinyl siding - **Damaged front shutter, Chalking noted due to age, One panel needs to be repositioned at rear elevation**



4. Trim: Aluminum - **Chalking noted due to age, Loose nails in areas**
5. Soffits: Vinyl - **Loose/sagging at front porch**
6. Patio Door: Vinyl sliding - **Resecure loose handle hardware, Screen damage noted**
7. Windows: Vinyl insulated - **Reseal caulking at window perimeters at brick window openings**



8. Hose Bibs: Gate - **Properly secure fixture(s) to exterior wall with fasteners**

### Roof

9. Gutters: Aluminum - **Loose nails, Sagging gutters at front and rear**



## Roof (Continued)

Gutters: (continued)



10. Leader/Extension: Splash blocks - **Splash block(s) not properly installed**



## Garage

11. Attached Garage Walls: Drywall - **Hole(s) noted in walls**  
12. Attached Garage Floor/Foundation: Poured concrete - **Minor floor cracks noted-seal cracks**  
13. Attached Garage Electrical: 110 VAC - **Fluorescent lighting missing covers and lenses**

## Electrical

14. 120 VAC Branch Circuits: Copper and aluminum - **Evaluation by a licensed electrician is recommended, See aluminum wiring notes below**  
15. Aluminum Wiring: Present at several circuits - **Aluminum branch wiring has had a history of problems relating to poor connections due to galvanic corrosion, dissimilar metals, brittle conductors and type of aluminum alloy used during the time period of 1965 through 1972. These problems create unsatisfactory conditions at connections and splice locations and therefore create potential fire hazards. Recommend wiring update for aluminum wiring by a licensed electrician, Circuits are recommended to be upgraded with special compression type connectors at splices and branch circuits to reduce the potential risks of aluminum branch wiring.(Cop-Alum Crimp System)**



## Marginal Summary (Continued)

### Attic

16. Attached Garage Attic Roof Framing: 2x3/4 Truss - Wood blocking components missing at chimney perimeter



17. Attached Garage Attic Sheathing: Plywood - Water stains and slight damage present, Areas of sheathing have been repaired



18. Main Attic Sheathing: Plywood - Poor repair at 2 areas near ridge at rear slope - No H clips installed and repair only spanned one truss - Recommend additional support be installed



### Structure



19. Joists/Trusses: 2x10 - Areas not visible due to ceiling finishes or other obstructions, Framing joist near fireplace chimney shows evidence of previous termite infestation - No repairs required, Seal penetration as required



## Marginal Summary (Continued)

### Basement

- 20. Main Basement Floor: Carpet - **Carpet stains noted**
- 21. Main Basement Electrical: 110 VAC - **Loose junction boxes, missing and mis-sized covers, extension cord wiring to projector**

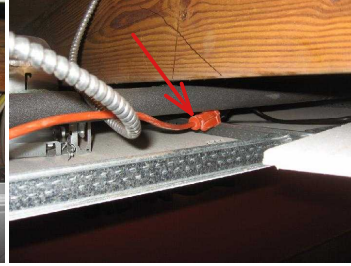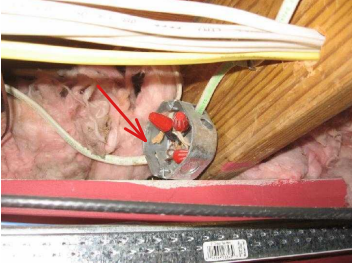

### Bathroom

- 22. Master Bathroom Floor: Laminated flooring - **Gapping noted in planks**
- 23. Master Bathroom Shower/Surround: Ceramic tile - **Leaking at corner of door frame**



- 24. 2nd Floor Hall Bathroom Closet: Large - **Alignment needed at closet doors**
- 25. 2nd Floor Hall Bathroom Floor: Laminated flooring - **Gapping noted in planks**
- 26. 1st Floor Hall Half Bathroom Floor: Ceramic tile - **Cracked tile noted**



### Kitchen

- 27. 1st Floor Kitchen Dishwasher: Maytag - **Properly secure the dishwasher discharge hose so that it creates a "high loop" above the basin drain to minimize food or water backup under dishwasher**





## Marginal Summary (Continued)

28. 1st Floor Kitchen Sink: Stainless Steel - Chipping at drain

Living Space

29. 1st Floor Living Space Closet: Various - Missing door glides at bypass closet door in Foyer



30. 1st Floor Living Space Floor: Ceramic tile, Carpet, Hardwood - Worn wood finish in Family room





## Defective Summary

This summary is not the entire report. The complete report may include additional information of concern to the client. It is recommended that the client read the complete report.

### Lots and Grounds

1. Porch: Concrete - **Settling away from foundation with surface cracks noted**



### Garage

2. Attached Garage Service Doors: Wood - **Wood rot at bottom of door and frame**



### Heating System

3. Basement Heating System Humidifier: General - **Inoperative - Requires service/replacement**  
**Plumbing**

4. Drain Pipes: Cast iron, Copper - **Pitting cast iron drain piping stack - replace affected sections where required**



### Bathroom

5. 2nd Floor Hall Bathroom Faucets/Traps: Delta fixtures with a metal trap - **Leaking shower head, Loose trim rings**

## Bathroom (Continued)

Faucets/Traps: (continued)



## Kitchen

6. 1st Floor Kitchen Windows: Vinyl Insulated - Insulated glass unit seal failure

